# Electronic Transmittal Form for DEEP Remediation and LUST Secure File Transfer (SFT)

DEPARTMENT OF ENERGY AND ENVIRONMENTAL PROTECTION
REMEDIATION DIVISION
LEAKING UNDERGROUND STORAGE TANK COORDINATION PROGRAM
www.ct.gov/deep

This Electronic Transmittal Form must be completed and included as the cover sheet of your electronic document when uploading a document to the Connecticut SFT website. Requirements for Transmittals through the SFT website:

- Only document types identified in the dropdown lists in Part III below may be submitted through the SFT website.
- Documents submitted through the SFT website must include all applicable figures, tables and laboratory data.
- Files must be formatted as PDF/A and use the appropriate naming convention:
  - For Remediation Filings: **REM_RemID_DocumentType_DateofDocument**
    **Example:** REM_1234_MonitoringReport_01-01-2001
  - For LUST Filings: **LUST_SiteAddress_Town_AbbreviationForDocumentType_DateofDocument**
    **Example:** LUST_1MainStreet_Hartford_ESA_01-01-2001
    **Note:** For "AbbreviationForDocumentType" use appropriate abbreviation at Transmittal of Documents

**Part I: Primary Recipient*: Remediation Program** (* required)

| For Remediation documents: | For LUST documents: |
|---|---|
| Primary Program*: Property Transfer | UST Facility ID: |
| Rem ID*: 11169 | Spill Case Number: |

**Part II: Site Information**

Site Name*: Former C L & P Operations Center
Site Address*: 176 Cumberland Avenue
City/Town*: Wethersfield State: CT Zip Code: 06109

Secondary Programs (complete as many as applicable for this document):

| | |
|---|---|
| Program: Select Secondary Program | Project ID: |
| Program: Select Secondary Program | Project ID: |
| Program: Select Secondary Program | Project ID: |
| Program: Select Secondary Program | Project ID: |

Provide Project ID for each secondary program if it is known.
Each program has a unique ID (i.e. Rem ID, Spill Case #, UST Facility ID, etc.)

**Part III: Document Information** (document type required for appropriate program[s] only)

Remediation*: Annual Report
LUST*:
Date of Document*: 9/20/2022 Version: Final

**Part IV: Submitter Information**

Name*: Don Wilson
E-mail*: dwilson@apexcos.com
Name of company/business this document is being submitted on behalf of: *
Eversource

VIA CTDEEP SFT

September 20, 2022

Mr. David Ringquist
Remediation Division
Bureau of Water Protection and Land Reuse
Connecticut Department of Energy and Environmental Protection
79 Elm Street
Hartford, CT 06106-5127

RE: 2022 Status Report
Former CL&P Operations Center
176 Cumberland Avenue
Wethersfield, Connecticut
REM ID: 11169

Dear Mr. Ringquist:

Apex Companies, LLC, on behalf of Eversource Energy Service Company (Eversource), has prepared the attached Status Report for environmental activities that have been conducted at the former The Connecticut Light and Power Company dba Eversource Energy (CL&P) facility located at 176 Cumberland Avenue in Wethersfield, Connecticut. The report summarizes the activities conducted in 2022.

As noted in the 2021 Status Report, based on the soil and groundwater analytical results, it is Apex's opinion that no further soil and/or groundwater sampling is needed within any of the AOCs previously identified for the Site. As such, with the completion of the additional well decommissioning activities documented in the attached Status Report, no further environmental activities are anticipated for this Site by Eversource.

Should you have any questions regarding the information presented, please contact either of the undersigned at (860) 282-1700.

Sincerely,

***APEX COMPANIES, LLC***

Don E. Wilson
Project Manager

***APEX COMPANIES, LLC***

Kyle Fortin
Program Director

ecc: Ms. Amy Voisine-Shea, Eversource
Mr. David Lansey, ABC Properties/Fisher Associates

# 2022 ANNUAL STATUS REPORT

**Former CL&P Operations Center**
**176 Cumberland Avenue**
**Wethersfield, Connecticut**
**REM ID: 11169**

September 20, 2022

Apex Project No.: 6089-015

Prepared for:

Eversource Energy Service Company
P.O. Box 270
Hartford, CT 06141-0270

Prepared by:

Apex Companies, LLC
58H Connecticut Avenue
South Windsor, CT 06074-3452

**TABLE OF CONTENTS**

**1.0 INTRODUCTION ..... 1**
**2.0 SITE BACKGROUND ..... 1**
**3.0 SOIL REMEDIATION ..... 2**
**4.0 GROUNDWATER MONITORING WELL REPLACEMENT AND GROUNDWATER SAMPLING ..... 2**
**5.0 GROUNDWATER MONITORING WELL ABANDONMENT ..... 3**
**6.0 FUTURE ACTIVITIES ..... 3**

***FIGURES***

Figure 1: Site Location Map
Figure 2: Site Plan

***APPENDICES***

Appendix A: Well Abandonment Completion Forms

## 1.0 INTRODUCTION

Apex Companies, LLC (Apex), on behalf of Eversource Energy Service Company (Eversource), has prepared the following Status Report for environmental activities conducted at the former The Connecticut Light and Power Company (CL&P) facility located at 176 Cumberland Avenue in Wethersfield, Connecticut (the Site). This report summarizes environmental activities conducted in 2022.

## 2.0 SITE BACKGROUND

On October 4, 2012, the Connecticut Department of Energy and Environmental Protection (CTDEEP) issued a letter to Wethersfield, LLC acknowledging receipt of a Form III and an Environmental Condition Assessment Form (ECAF) in support of a transfer of the property from Wethersfield, LLC to the Capitol Region Education Council (CREC). Wethersfield, LLC was the Certifying Party for the transfer, and Eversource is currently monitoring the completion of certain remediation activities at the Site. Note that while Eversource is performing certain environmental activities at the Site, Eversource is not the Certifying Party per the Connecticut Transfer Act. Responsibility for oversight of assessment and remediation at this Site has been delegated to a Connecticut Licensed Environmental Professional (LEP) under Connecticut General Statutes (CGS) Section 22a-134a(e). A Schedule for Investigation and Remediation letter was submitted to CTDEEP on December 17, 2012.

The Site was initially developed in the mid-1950s by CL&P (a subsidiary of Northeast Utilities [NU], now known as Eversource Energy) primarily for use as a call/data center. Additional uses included vehicle maintenance and equipment warehousing. Records indicate that CL&P and other NU companies (collectively referred to herein as NU) occupied the Site from the mid-1950s until 2006. These records also indicate that the Site was owned by a series of real estate companies for which NU was a tenant. Town of Wethersfield records document that Wethersfield, LLC purchased the property in 1998, and CREC is the current property owner.

The Site has been redeveloped by CREC for use as a school (CREC Discovery Academy). The redevelopment plan involved the preservation of certain portions of the Site structure and demolition of other portions of the site building. Construction was completed at the Site in the fall of 2015, and the school has been open since then.

The subject property is located in a mixed commercial and residential area of Wethersfield. The Site is bordered to the east and south primarily by residential properties. It is bordered to the northeast by office buildings, to the northwest by the Wilbur Cross Highway, and is primarily undeveloped and wooded to the west. The geographic location of the Site and its immediate surroundings are included on **Figure 1**.

According to the CTDEEP Water Quality Classification Map of Connecticut, groundwater beneath the Site is classified as GA, which is defined as groundwater that is suitable for drinking without treatment. A Site Plan depicting pertinent site features is included as **Figure 2**.

A Remedial Action Plan (RAP) was prepared by Apex and submitted to CTDEEP in April 2013. The RAP described site conditions, remedial goals, and remedial activities to be performed to address soil and groundwater impacts. As detailed in the RAP, Apex performed a review of remediation alternatives and determined that two remedial technologies were the most applicable and cost effective for remediating soil and groundwater at this Site: 1) excavation and off-site disposal of impacted soil and 2) monitored natural attenuation of impacted groundwater.

## 3.0 SOIL REMEDIATION

Soil excavation activities as outlined in the RAP were conducted by True Blue Environmental, Inc. of Wallingford, Connecticut on July 17, 2013 and were overseen by an Apex environmental scientist. Excavation activities were conducted in the vicinity of monitoring well AP-11, which was located in a former loading dock area on the western side of the original site building. Based on prior sampling results, extractable total petroleum hydrocarbons (ETPH) were identified as the contaminant of concern. The completed excavation measured 10 feet by 10 feet, centered on monitoring well AP-11, and extended to 12 feet below grade (fbg). A total of 69.75 tons of impacted soil was disposed of offsite at the Ted Ondrick Company, LLC facility in Chicopee, Massachusetts.

Confirmatory soil samples were collected by Apex personnel from 8 to 10 fbg on all four sidewalls and from the bottom of the excavation. The results of the laboratory analytical data indicate that there were no detections of ETPH above the laboratory reporting limits (RLs) in any of the post-excavation samples. Following receipt of the sampling results, the excavation was backfilled to grade with clean fill.

Based on the laboratory results, excavation of the impacted area was successful, and soil remediation was deemed to be completed for the Site. A letter report dated August 27, 2013 was submitted to CTDEEP to document the soil remediation activities.

## 4.0 GROUNDWATER MONITORING WELL REPLACEMENT AND GROUNDWATER SAMPLING

During redevelopment and related construction activities of the school, many groundwater monitoring wells were destroyed and required replacement. In September 2014, replacement wells AP-6R and AP-11R were installed. During June 2015, nine additional replacement groundwater monitoring wells (AP-1R, AP-2R, AP-3R, AP-4R, AP-9R, AP-12R, AP-13R, AP-15R, and AP-101R) were installed as described in the 2015 Annual Status Report. Since installation of the replacement wells in 2015, two new shallow bedrock wells (AP-13R-BR and AP-15R-BR) were also installed at the Site. Monitoring well locations are depicted on **Figure 2**.

Following the installation of the above monitoring wells, groundwater sampling has been conducted at the Site on either an annual or quarterly basis since 2015.

## 5.0 GROUNDWATER MONITORING WELL ABANDONMENT

Based on the groundwater analytical results, as stated in the 2021 status report, Apex recommended that no further groundwater sampling was needed within any of the other areas of concern (AOCs) previously identified for the Site.

As a result of the 2021 status report recommendations, Apex contracted Cisco Environmental of Glastonbury, Connecticut, a licensed Connecticut driller to properly abandon the twelve (12) on-site monitoring wells (AP-1R, AP-2R, AP-3R, AP-4R, AP-6R, AP-9R, AP-11R, AP-12R, AP-13R, AP-13R-BR, AP-15R-BR and AP-101R). During the removal/abandonment of these wells, the well materials were removed from the subsurface to the extent practical and then each well was backfilled with a bentonite/grout mixture to seal the borehole. Please note, for the two wells located inside the school building, the well materials were left in place and the wells were backfilled with a bentonite/grout. The well cover at each location was allowed to remain in place to preserve the interior floor. The location of the monitoring wells that were removed/abandoned are shown on **Figure 2**. Copies of the well abandonment forms that were prepared by Cisco are attached to this report as **Appendix A**.

## 6.0 FUTURE ACTIVITIES

As noted in the 2021 status report, based on the soil and groundwater analytical results, it is Apex's opinion that no further soil and/or groundwater sampling is needed within any of the other AOCs previously identified for the Site. As such, with the completion of the additional activities documented above, no further environmental activities are anticipated for this Site by Eversource.

*FIGURES*

**Figure 1**
**Site Location Map**

**176 Cumberland Avenue**
**Wethersfield, Connecticut**

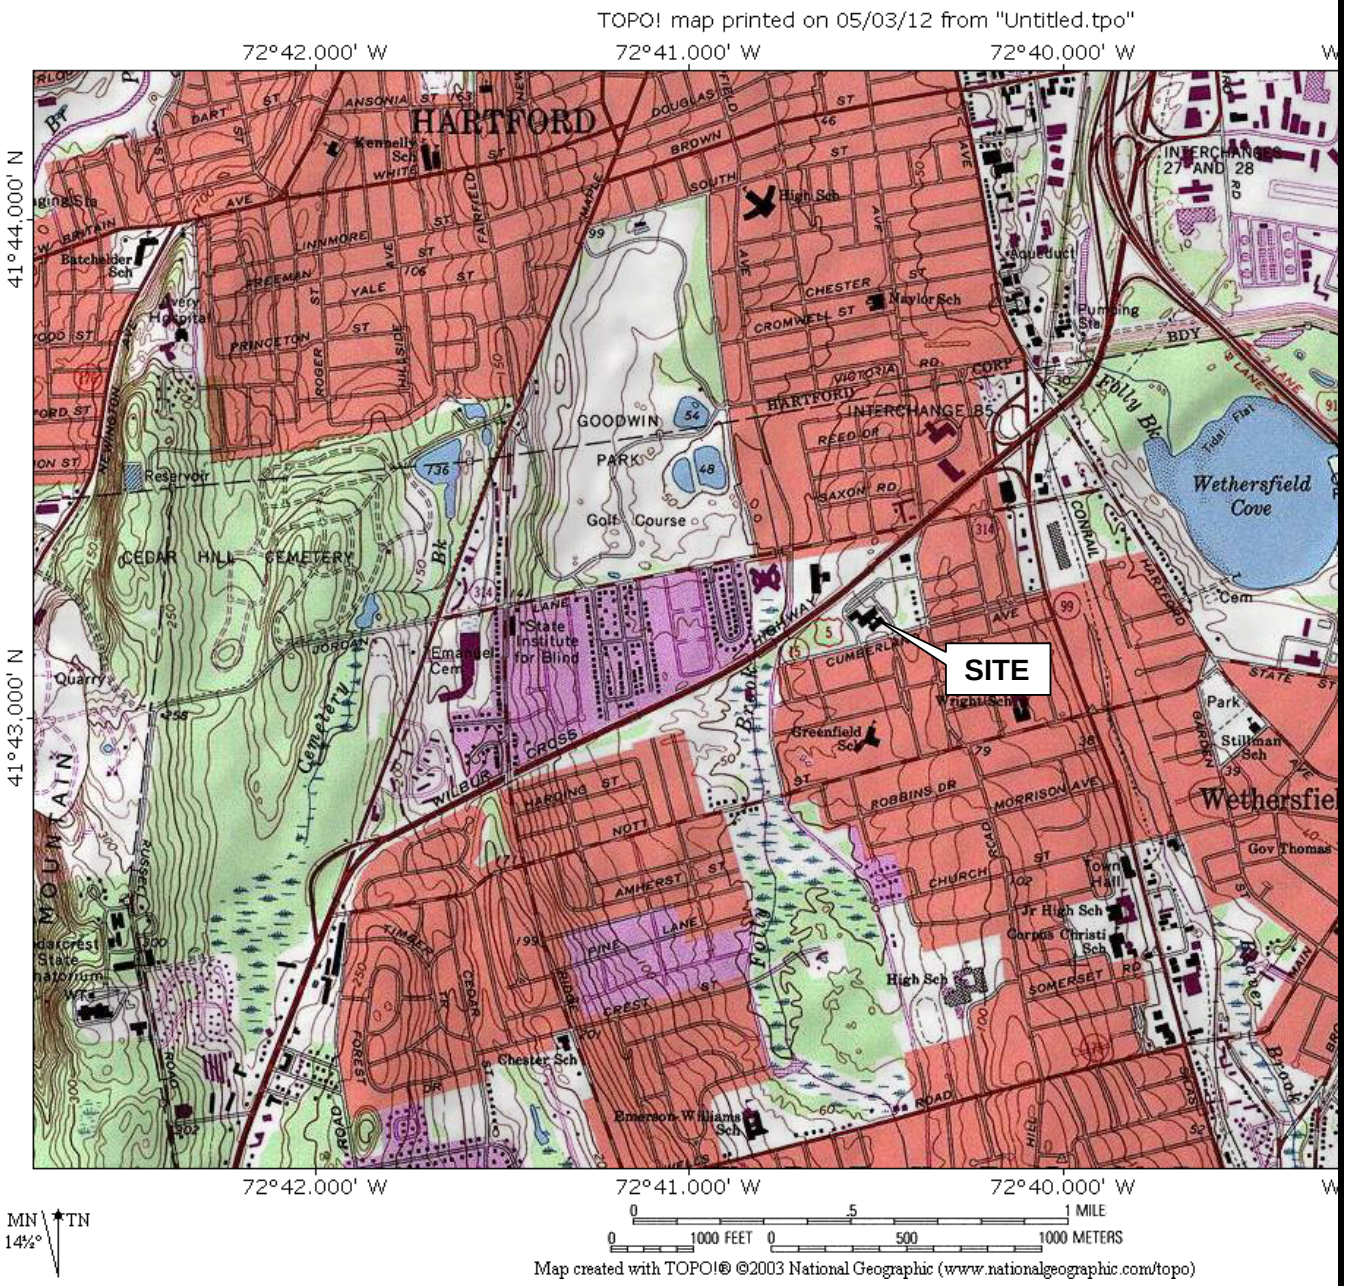


APEX
58H Connecticut Avenue
South Windsor, Connecticut
Telephone: (860) 282-1700

United States Department of the Interior
Geological Survey
7.5 Minute Series Topographic Map
Contour Interval: 20 feet
Scale: 1 inch = 2,000 feet

Wethersfield, Connecticut, 2019

Project:
Annual Report

Apex Job #: 6089-015A

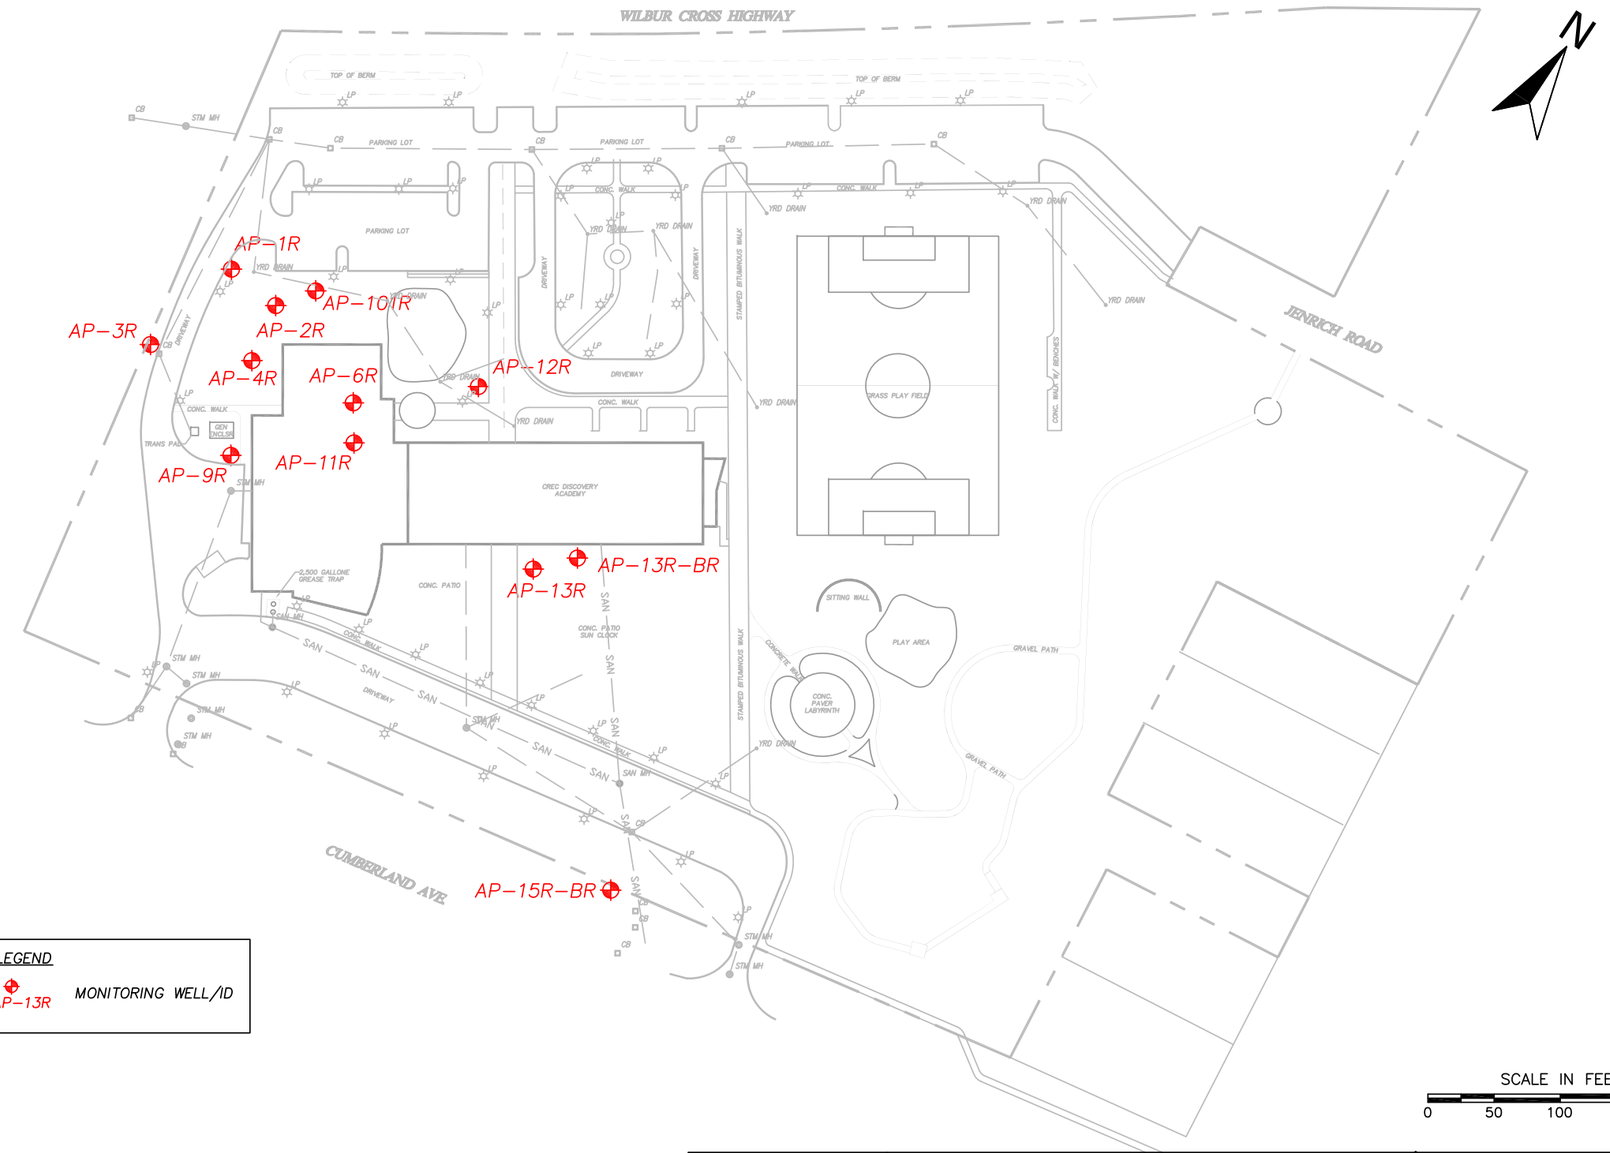


LEGEND

AP–13R MONITORING WELL/ID

NOTES:

THE BASE MAP WAS PREPARED BY O'BRIEN ASSOCIATES, INC. FILE 3395 DATED SEP. 29, 2015.

| | |
|---|---|
| CHECK BY | DK |
| DRAWN BY | MCK |
| DATE | 2/20/2019 |
| SCALE | 1"=100' |
| CAD NO. | FIGURE 1 |
| PRJ NO. | 6089–015 |

SITE PLAN

FORMER CL&P OPERATIONS CENTER
176 CUMBERLAND AVE.
WETHERSFIELD, CONNECTICUT

APEX

FIGURE 2

*APPENDIX A*

*MONITORING WELL ABANDONMENT COMPLETION FORMS*

DCP Public Well Drilling Completion Report

**Report**
Abandonment
report for Eversource Energy property

To view a map of all submitted reports, visit the CT Open Data Portal.

**Report Details** - Report Number 5568641

Drilling Company: Cisco Geotechnical
Credential Number: WNC.0000179-W3
Credential Holder: DIRK A BARRY
Well Type: Abandonment

**Owner:** Eversource Energy

Owner Address: 107 Selden Street
Owner City: Berlin
Owner State: Connecticut
Owner Zip: 06037

Well Address: 176 Cumberland Avenue
Well City: Wethersfield
Well State: Connecticut
Well Zip: 06109
Well Details: Well ID : AP-101R
Owner Address Same as Well: No

**Abandonement**
Type of Well: Drilled Monitoring well
Latitude: 41.72011
Longitude: -72.67619
Depth of Well: 16
Casing Diameter: 2
Casing Length: 6
Abandonment Materials: n/a
Grout Type-Amount: Bentonite Cement Grout Entire well grouted
Description: N/A
Date of Abandonment: 07/22/2022

**Links to Permits, Maps and Photos**
Permit
Map
Photo

DCP Public Well Drilling Completion Report

**Report**
Abandonment
report for Eversource Energy property

To view a map of all submitted reports, visit the CT Open Data Portal.

**Report Details** - Report Number 5563657

Drilling Company: Cisco Geotechnical
Credential Number: WNC.0000179-W3
Credential Holder: DIRK A BARRY
Well Type: Abandonment

**Owner:** Eversource Energy

Owner Address: 107 Selden Street
Owner City: Berlin
Owner State: Connecticut
Owner Zip: 06037

Well Address: 176 Cumberland Avenue
Well City: Wethersfield
Well State: Connecticut
Well Zip: 06109
Well Details: Well ID: AP-13R
Owner Address Same as Well: No

**Abandonement**
Type of Well: Drilled Monitoring well
Latitude: 41.71994
Longitude: -72.67525
Depth of Well: 8
Casing Diameter: 1.5
Casing Length: 3
Abandonment Materials: n/a
Grout Type-Amount: Bentonite/cement grout Entire well filled
Description: N/A
Date of Abandonment: 07/22/2022

**Links to Permits, Maps and Photos**
Permit
Map
Photo

DCP Public Well Drilling Completion Report

**Report**
Abandonment
report for Eversource Energy property

To view a map of all submitted reports, visit the CT Open Data Portal.

**Report Details** - Report Number 5568613

Drilling Company: Cisco Geotechnical
Credential Number: WNC.0000179-W3
Credential Holder: DIRK A BARRY
Well Type: Abandonment

**Owner:** Eversource Energy

Owner Address: 107 Selden Street
Owner City: Berlin
Owner State: Connecticut
Owner Zip: 06037

Well Address: 176 Cumberland Avenue
Well City: Wethersfield
Well State: Connecticut
Well Zip: 06109
Well Details: Well ID: AP-13R-BR
Owner Address Same as Well: No

**Abandonement**
Type of Well: Drilled Monitoring well
Latitude: 41.72004
Longitude: -72.67512
Depth of Well: 25
Casing Diameter: 2
Casing Length: 15
Abandonment Materials: n/a
Grout Type-Amount: Bentonite/ Cement Grout Entire well grouted
Description: N/A
Date of Abandonment: 07/22/2022

**Links to Permits, Maps and Photos**
Permit
Map
Photo

DCP Public Well Drilling Completion Report

**Report**
Abandonment
report for Eversource Energy property

To view a map of all submitted reports, visit the CT Open Data Portal.

**Report Details** - Report Number 5568626

Drilling Company: Cisco Geotechnical
Credential Number: WNC.0000179-W3
Credential Holder: DIRK A BARRY
Well Type: Abandonment

**Owner:** Eversource Energy

Owner Address: 107 Selden Street
Owner City: Berlin
Owner State: Connecticut
Owner Zip: 06037

Well Address: 176 Cumberland Avenue
Well City: Wethersfield
Well State: Connecticut
Well Zip: 06109
Well Details: Well ID: AP-15R-BR
Owner Address Same as Well: No

**Abandonement**
Type of Well: Drilled Monitoring well
Latitude: 41.71951
Longitude: -72.67446
Depth of Well: 25
Casing Diameter: 2
Casing Length: 15
Abandonment Materials: n/a
Grout Type-Amount: Bentonite cement grout Entire well grouted
Description: N/A
Date of Abandonment: 07/22/2022

**Links to Permits, Maps and Photos**
Permit
Map
Photo

DCP Public Well Drilling Completion Report

**Report**
Abandonment
report for Eversource Energy property

To view a map of all submitted reports, visit the CT Open Data Portal.

**Report Details** - Report Number 5562824

Drilling Company: Cisco Geotechnical
Credential Number: WNC.0000179-W3
Credential Holder: DIRK A BARRY
Well Type: Abandonment

**Owner:** Eversource Energy

Owner Address: 107 Belden Street
Owner City: Berlin
Owner State: Connecticut
Owner Zip: 06037

Well Address: 176 Cumberland Avenue
Well City: Wethersfield
Well State: Connecticut
Well Zip: 06109
Well Details: Well ID : AP-12R
Owner Address Same as Well: No

**Abandonement**
Type of Well: Drilled Monitoring well
Latitude: 41.72016
Longitude: -72.67567
Depth of Well: 15
Casing Diameter: 2
Casing Length: 5
Abandonment Materials: n/a
Grout Type-Amount: Bentonite/Cement Grout Entire well grouted
Description: N/A
Date of Abandonment: 07/22/2022

**Links to Permits, Maps and Photos**
Permit
Map
Photo

DCP Public Well Drilling Completion Report

**Report**
Abandonment
report for Eversource Energy property

To view a map of all submitted reports, visit the CT Open Data Portal.

**Report Details** - Report Number 5562694

Drilling Company: Cisco Geotechnical
Credential Number: WNC.0000179-W3
Credential Holder: DIRK A BARRY
Well Type: Abandonment

**Owner:** Eversource Energy

Owner Address: 107 Selden Street
Owner City: Berlin
Owner State: Connecticut
Owner Zip: 06037

Well Address: 176 Cumberland Avenue
Well City: Wethersfield
Well State: Connecticut
Well Zip: 06109
Well Details: Well ID : AP-11R
Owner Address Same as Well: No

**Abandonement**
Type of Well: Drilled Monitoring well
Latitude: 41.71992
Longitude: -72.67585
Depth of Well: 19
Casing Diameter: 2
Casing Length: 9
Abandonment Materials: n/a
Grout Type-Amount: Bentonite/ Cement Grout Entire Well Grouted
Description: N/A
Date of Abandonment: 07/22/2022

**Links to Permits, Maps and Photos**
Permit
Map
Photo

DCP Public Well Drilling Completion Report

**Report**
Abandonment
report for Eversource Energy property

To view a map of all submitted reports, visit the CT Open Data Portal.

**Report Details** - Report Number 5562675

Drilling Company: Cisco Geotechnical
Credential Number: WNC.0000179-W3
Credential Holder: DIRK A BARRY
Well Type: Abandonment

**Owner:** Eversource Energy

Owner Address: 107 Selden Street
Owner City: Berlin
Owner State: Connecticut
Owner Zip: 06037

Well Address: 176 Cumberland Avenue
Well City: Wethersfield
Well State: Connecticut
Well Zip: 06109
Well Details: Well ID: AP-9R
Owner Address Same as Well: No

**Abandonement**
Type of Well: Drilled Monitoring well
Latitude: 41.71974
Longitude: -72.67609
Depth of Well: 17
Casing Diameter: 2
Casing Length: 7
Abandonment Materials: n/a
Grout Type-Amount: Bentonite/ cement Grout Entire well grouted
Description: N/A
Date of Abandonment: 07/22/2022

**Links to Permits, Maps and Photos**
Permit
Map
Photo

DCP Public Well Drilling Completion Report

**Report**
Abandonment
report for Eversource Energy property

To view a map of all submitted reports, visit the CT Open Data Portal.

**Report Details** - Report Number 5562618

Drilling Company: Cisco Geotechnical
Credential Number: WNC.0000179-W3
Credential Holder: DIRK A BARRY
Well Type: Abandonment

**Owner:** Eversource Energy

Owner Address: 107 Selden Street
Owner City: Berlin
Owner State: Connecticut
Owner Zip: 06037

Well Address: 176 Cumberland Avenue
Well City: Wethersfield
Well State: Connecticut
Well Zip: 06109
Well Details: Well ID: AP-6R
Owner Address Same as Well: No

**Abandonement**
Type of Well: Drilled Monitoring well
Latitude: 41.72002
Longitude: -72.67592
Depth of Well: 20
Casing Diameter: 2
Casing Length: 10
Abandonment Materials: N/A
Grout Type-Amount: Bentonite/Cement Grout Entire Well Grouted
Description: N/A
Date of Abandonment: 07/22/2022

**Links to Permits, Maps and Photos**
Permit
Map
Photo

DCP Public Well Drilling Completion Report

**Report**
Abandonment
report for Eversource Energy property

To view a map of all submitted reports, visit the CT Open Data Portal.

**Report Details** - Report Number 5562590

Drilling Company: Cisco Geotechnical
Credential Number: WNC.0000179-W3
Credential Holder: DIRK A BARRY
Well Type: Abandonment

**Owner:** Eversource Energy

Owner Address: 107 Selden Street
Owner City: Berlin
Owner State: Connecticut
Owner Zip: 06037

Well Address: 176 Cumberland Avenue
Well City: Wethersfield
Well State: Connecticut
Well Zip: 06109
Well Details: Well ID: AP-4R
Owner Address Same as Well: No

**Abandonement**
Type of Well: Drilled Monitoring well
Latitude: 41.71992
Longitude: -72.67621
Depth of Well: 15
Casing Diameter: 2
Casing Length: 5
Abandonment Materials: n/a
Grout Type-Amount: Bentonite/ cement Grout Entire well grouted
Description: N/A
Date of Abandonment: 07/22/2022

**Links to Permits, Maps and Photos**
Permit
Map
Photo

DCP Public Well Drilling Completion Report

**Report**
Abandonment
report for Eversource Energy property

To view a map of all submitted reports, visit the CT Open Data Portal.

**Report Details** - Report Number 5562569

Drilling Company: Cisco Geotechnical
Credential Number: WNC.0000179-W3
Credential Holder: DIRK A BARRY
Well Type: Abandonment

**Owner:** Eversource Energy

Owner Address: 107 Selden Street
Owner City: Berlin
Owner State: Connecticut
Owner Zip: 06037

Well Address: 176 Cumberland Avenue
Well City: Wethersfield
Well State: Connecticut
Well Zip: 06109
Well Details: Well ID: AP-3R
Owner Address Same as Well: No

**Abandonement**
Type of Well: Drilled Monitoring well
Latitude: 41.70982
Longitude: -72.67643
Depth of Well: 11
Casing Diameter: 2
Casing Length: 6
Abandonment Materials: n/a
Grout Type-Amount: Bentonite/cement grout Entire well filled
Description: N/A
Date of Abandonment: 07/22/2022

**Links to Permits, Maps and Photos**
Permit
Map
Photo

DCP Public Well Drilling Completion Report

**Report**
Abandonment
report for Eversource Energy property

To view a map of all submitted reports, visit the CT Open Data Portal.

**Report Details** - Report Number 5562545

Drilling Company: Cisco Geotechnical
Credential Number: WNC.0000179-W3
Credential Holder: DIRK A BARRY
Well Type: Abandonment

**Owner:** Eversource Energy

Owner Address: 107 Selden Street
Owner City: Berlin
Owner State: Connecticut
Owner Zip: 06037

Well Address: 176 Cumberland Avenue
Well City: Wethersfield
Well State: Connecticut
Well Zip: 06109
Well Details: Well ID: AP-2R
Owner Address Same as Well: No

**Abandonement**
Type of Well: Drilled Monitoring well
Latitude: 41.72007
Longitude: -72.67626
Depth of Well: 12
Casing Diameter: 2
Casing Length: 2
Abandonment Materials: n/a
Grout Type-Amount: Bentonite /Cement Grount Entire well grouted
Description: N/A
Date of Abandonment: 07/22/2022

**Links to Permits, Maps and Photos**
Permit
Map
Photo

DCP Public Well Drilling Completion Report

**Report**
Abandonment
report for Eversource Energy property

To view a map of all submitted reports, visit the CT Open Data Portal.

**Report Details** - Report Number 5562475

Drilling Company: Cisco Geotechnical
Credential Number: WNC.0000179-W3
Credential Holder: DIRK A BARRY
Well Type: Abandonment

**Owner:** Eversource Energy

Owner Address: 107 Selden Street
Owner City: Berlin
Owner State: Connecticut
Owner Zip: 06037

Well Address: 176 Cumberland Avenue
Well City: Wethersfield
Well State: Connecticut
Well Zip: 06109
Well Details: Well ID : AP-1R
Owner Address Same as Well: No

**Abandonement**
Type of Well: Drilled Monitoring well
Latitude: 41.72008
Longitude: -72.67642
Depth of Well: 14
Casing Diameter: 2
Casing Length: 4
Abandonment Materials: n/a
Grout Type-Amount: Bentonite/cement grout Entire well grouted
Description: n/a
Date of Abandonment: 07/22/2022

**Links to Permits, Maps and Photos**
Permit
Map
Photo